

AL153 Fan1/2 fault

speed control fan 1/2 fault

Cause analysis


- The fan drive dial switch is abnormal;
- The fan wiring is loosing;
- The software version is too old;
- The fan drive is broken;
- The motor is broken.

AL153 Fan1/2 fault speed control fan 1/2 fault

SPRSUN

Solution

- The fan drive dial switch needs to be dialed again, 1 on the digital side, 2 on the ON side

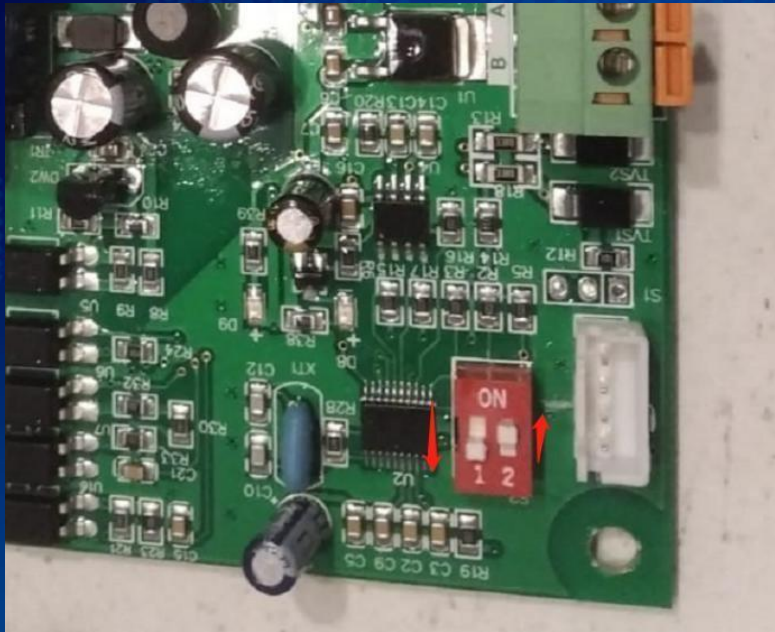

AL153 Fan1/2 fault speed control fan 1/2 fault

Solution

- Insert the fan wiring socket tightly

